
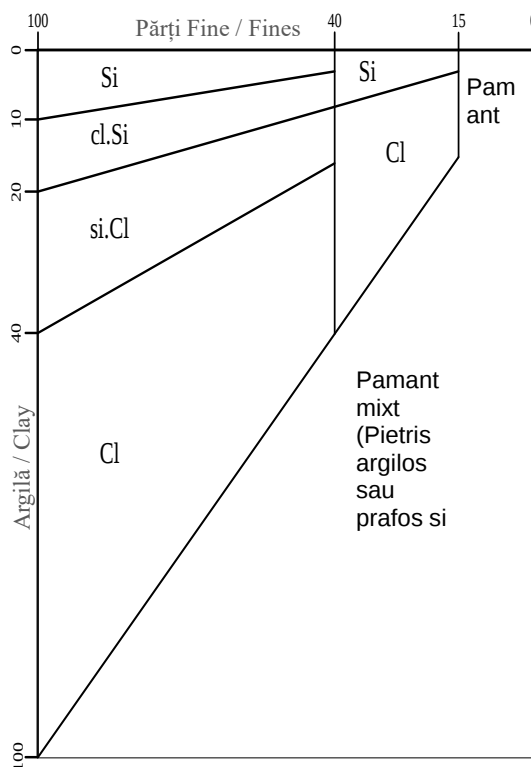


Amplasament / Location	Reabilitarea liniei de cale ferata Roman – Iasi - Frontiera
Forajul/Borehole:	Pod 18
Proba/Sample:	PT 7
Adancimea/Depth(m):	10,00

	d (mm)	mp (%)
CERNERE	100	100,0
	100	100,0
	100	100,0
	100	100,0
	100	100,0
	100	100,0
	90	100,0
	63	100,0
	45	100,0
	31,5	100,0
	22,4	100,0
	16	100,0
	11,2	100,0
	5,6	100,0
	3,15	100,0
SEDIMENTARE	2	99,5
	0,5	95,0
	0,25	68,8
	0,10	29,2
	0,063	13,1
	0,063	13,08
	0,060	13,02
	0,043	9,80
	0,030	9,27
	0,021	8,73
	0,016	8,20
	0,011	6,59
	0,008	4,99
0,006	0,00	
0,004	0,00	
0,003	0,00	
0,002	0,00	

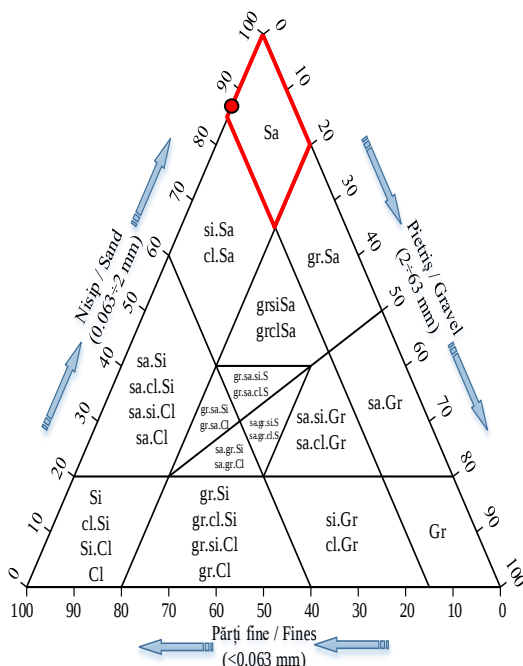

Tip pamant / Soil group	Tip fractiune		%	C _u (Un)	C _c	Forma curbei granulometrice / Shape of grading curve	C _u (Un)	C _c
Pamant fin / Fine	Argila	Cl	0				4,96	#####
	Praf	Si	13	<3	< 1	Foarte uniforma /Very uniform		
Pamant grosier / Coarse	Nisip	Sa	87	3----6	< 1	Uniforma / Uniform		
	Pietris	Gr	0	6----15	< 1	Uniformitate medie / Medium uniformity		
Pamant foarte grosier / Very coarse	Bolovanis	Co		>15	1---3	Neuniforma / Non-uniform		
				>15	<0,5	Discontinua/Gap graded		

Sef Laborator / Laboratory head: Constanta ANDREI

operator / Laborator
LABORATOR GTF
INCERCĂRI ÎN CONSTRUCȚII - GR. II
Aut. ISC - Nr. 294/15.08.2014
Județul Ilfov